




# 模具專用快速接頭 MOLD CUPLA



## プラグ (PLUG) P

## S ソケット (SOCKET)

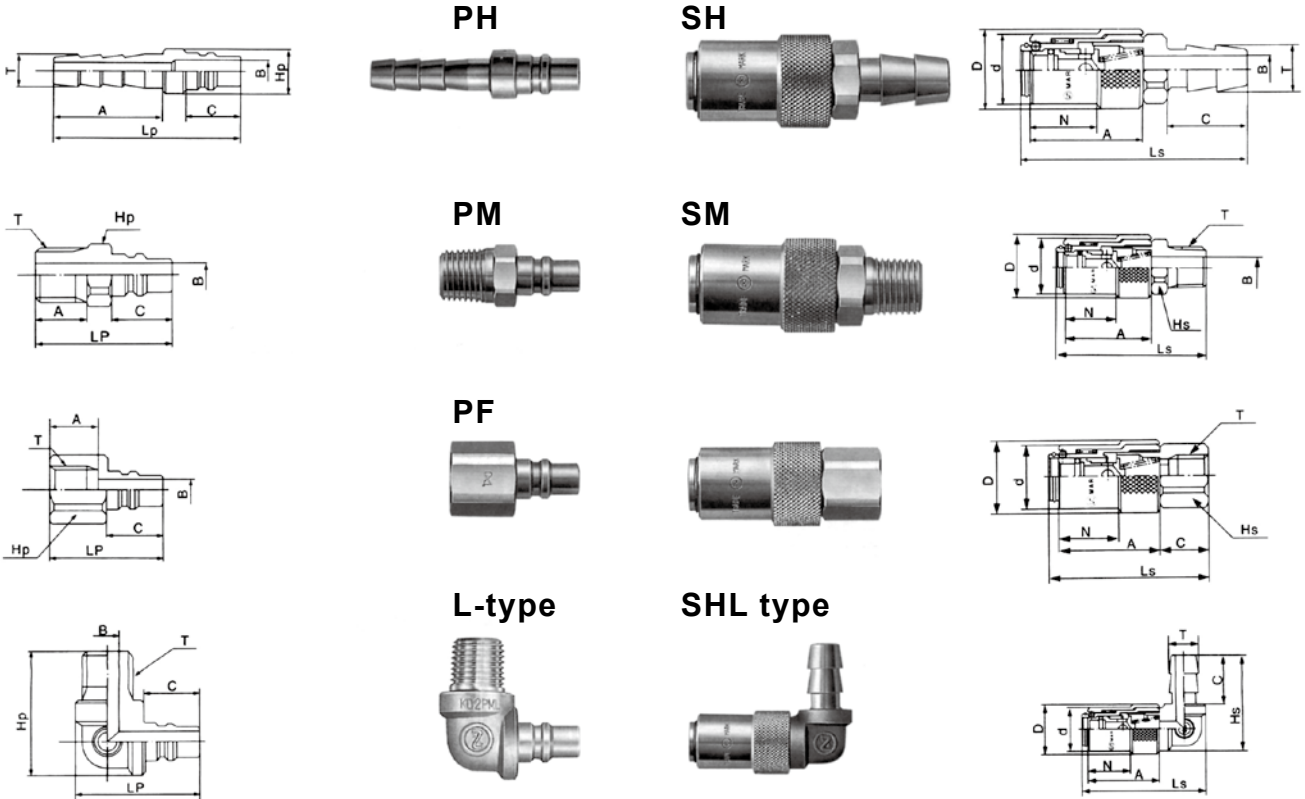

品 號	型 式	LP	C	HP	A	T	B
112010045	K02PH	50	15	12	29	8	5
112010050	K03PH	42	15	15	21	45	6
112010100	K01PM	31	15	12	10	PT1/8"	5
112010110	K02PM	34	15	14	13	PT1/4"	6
112010120	K03PM	35	15	19	14	PT3/8"	6
112010200	K01PF	28	15	14	10	PT1/8"	6
112010210	K02PF	30.5	15	17	13	PT1/4"	6
112010220	K03PF	32	15	21	14	PT3/8"	6
112010105	K01PML	33.5	15	30.5		PT1/8"	5
112010115	K02PML	33.5	15	33.5		PT1/4"	6
112010130	K03PML	33.5	15	33.5		PT3/8"	6
	K3-02PM	36	17.5	14		PT1/4"	
	K3-03PM	36	17.5	17		PT3/8"	
	K4-04PM	46	21.5	22		PT1/2"	

品 號	型 式	LS	A	C	D	d	N	T	B
112010580	K02SH	67	29	29	21	18.5	18	8	6
112010600	K03SH	59	29	21	21	18.5	18	12	7
112010810	K02SM	51	29		21	18.5	18	PT1/8"	6
112010820	K03SM	51	29		21	18.5	18	PT3/8"	6
112010500	K02SF	47.5	29	14.5	21	18.5	18	PT1/4"	
112010555	K02SHL	52	29	21	21	18.5	18	8	
112010605	K03SHL	52	29	21	21	18.5	18	12	
	K3-03SH	65	25.5		24	22.5	19	12	
	K4-04SH	82	34		32	30	26.5	15	

**耐 壓 力**：常用 10kg/cm<sup>2</sup>，最高 15kg/cm<sup>2</sup>，溫度：- 20℃~+ 80℃  
**模具專用快速接頭**：為了使模具交換時，更加省力化，日東工器特製模具專用快速接頭接續及分離非常快速又簡單，冷卻用膠管，只要 ONE-TOUCH 就可交換。  
**適 用 流 體**：水、油